

# Lincoln Mark VII 1984 - 1992 Air Dryer Lines

© The Lincoln Mark VII Club, Inc


Turn off the suspension switch.  
Disconnect the battery.



## AIR DRYER LINES MAINTENANCE AND REPAIR




Using a small blade screwdriver,  
remove the dryer boot and save.  
© The Lincoln Mark VII Club

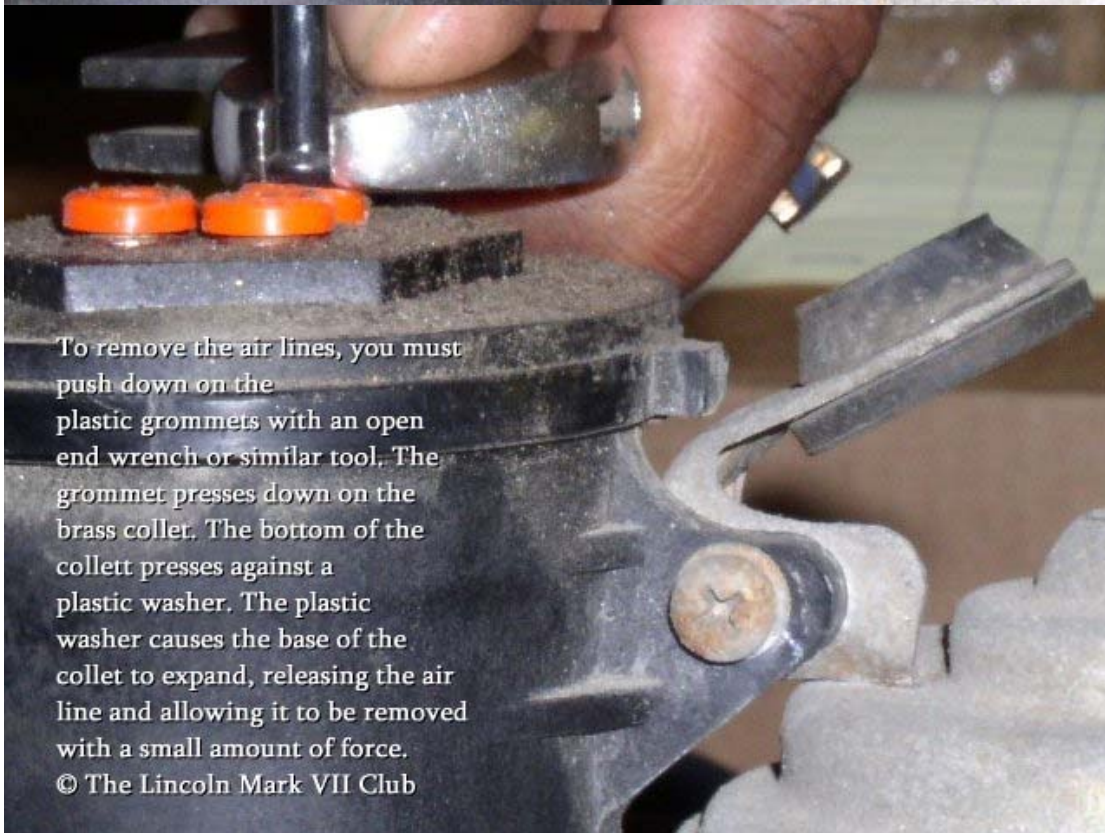

To remove the air lines, you must  
push down on the  
plastic grommets with an open  
end wrench or similar tool. The  
grommet presses down on the  
brass collet. The bottom of the  
collet presses against a  
plastic washer. The plastic  
washer causes the base of the  
collet to expand, releasing the air  
line and allowing it to be removed  
with a small amount of force.  
© The Lincoln Mark VII Club




## AIR DRYER LINES MAINTENANCE AND REPAIR

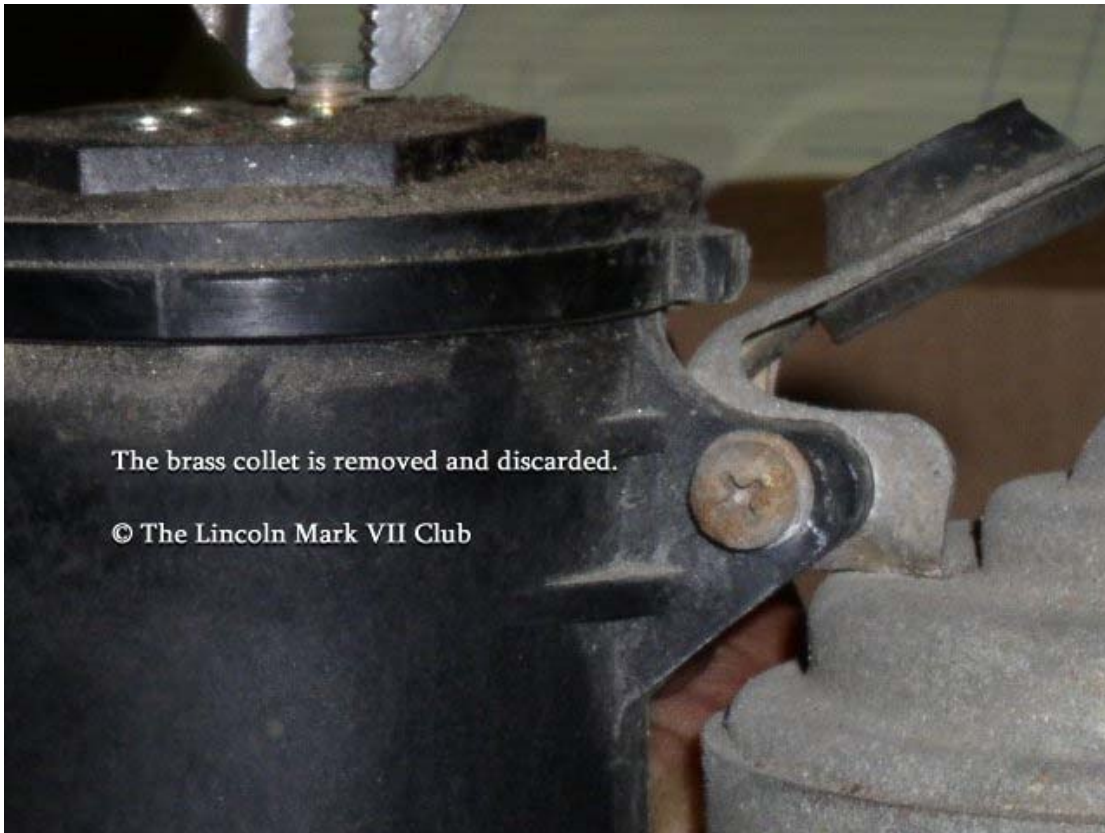

The brass collet is removed and discarded.

© The Lincoln Mark VII Club

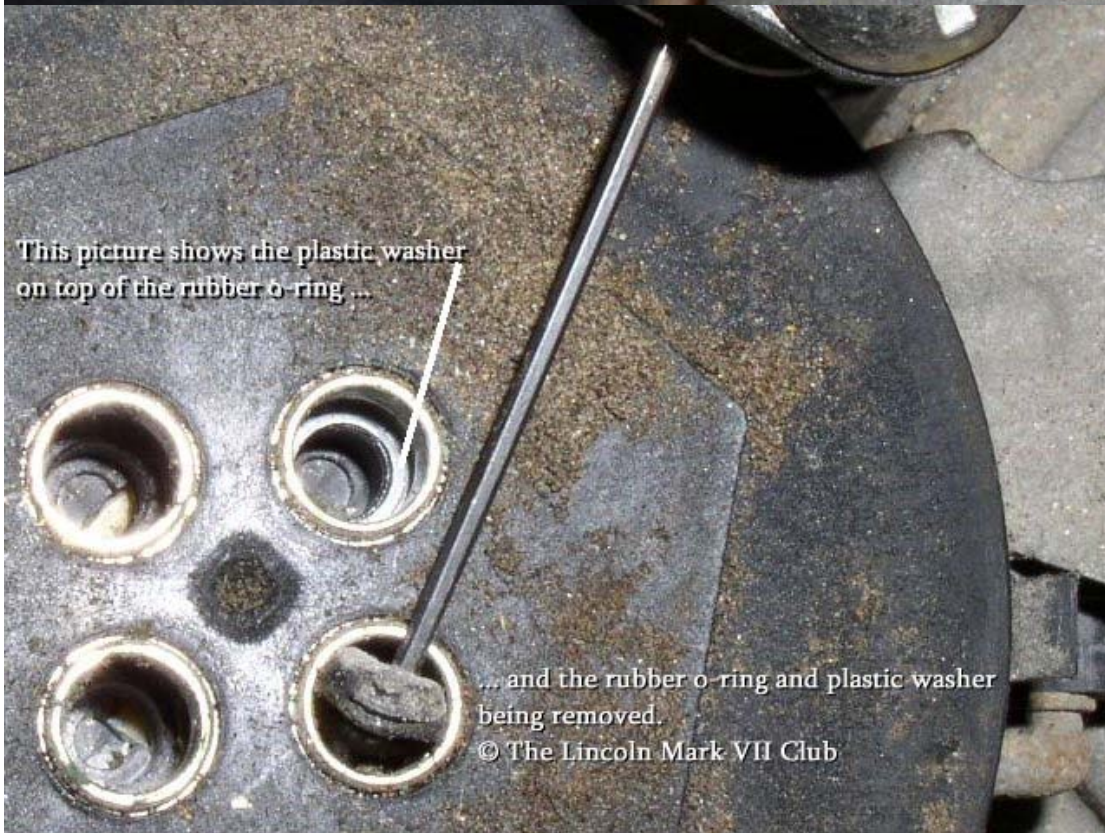

This picture shows the plastic washer  
on top of the rubber o-ring ...

... and the rubber o-ring and plastic washer  
being removed.

© The Lincoln Mark VII Club



## AIR DRYER LINES MAINTENANCE AND REPAIR



## AIR DRYER LINES MAINTENANCE AND REPAIR

